

Federal Aviation Administration

[RGL Home](#)

Airworthiness Directive

▶ Federal Register Information

▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

Amendment 39-803; AD 64-20-01

HARTZELL Models HC-C2YK-1/7666-2 and HC-E2YL-2B/7663-4 Propellers

PDF Copy (If Available):

▼ Preamble Information

AGENCY: Federal Aviation Administration, DOT

DATES: Effective August 28, 1964.

▼ Regulatory Information

64-20-01 HARTZELL: Amdt. 803 Part 507 Federal Register August 28, 1964. Applies to Models HC-C2YK-1/7666-2 Serial Numbers AW-1 to AW-603 and HC-E2YL-2B/7663-4 Propellers Serial Numbers BG-1 to BG-777.

Compliance required as indicated.

There have been incidents of failure of the plastic pitch change blocks in Hartzell HC- E2YL-2B and HC-C2YK-1 propellers which resulted in severe roughness or vibration in flight. To correct this condition, accomplish the following:

(a) Inspect propeller blades for pitch change movement and replace plastic pitch change blocks as necessary in accordance with Hartzell Service Bulletin No. 86 revised June 17, 1964, within 10 hours' time in service after the effective date of this AD unless already accomplished within the last 10 hours' time in service, and thereafter within every 10 hours' time in service from the last inspection.

(b) When the modification specified in Hartzell Service Bulletin No. 86, revised June 17, 1964, has been accomplished, the repetitive inspections specified in paragraph (a) may be discontinued.

(Hartzell Service Bulletin No. 86, revised June 17, 1964, covers this same subject.)

This directive effective August 28, 1964.

▼ **Footer Information**

▼ **Comments**

[FAA.gov Home](#) | [Privacy Policy](#) | [Web Policies & Notices](#) | [Contact Us](#) | [Help](#)

Readers & Viewers: [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)